



Technical Support
319.531.7574
support@digifarm.com



Quick Reference Card


Trimble XCN 2050/ TMX 2050 & RV50 Installation & Set-up

Trimble XCN 2050/ TMX 2050 Display Setup

- 1 Install the RV50 cable into the EXP-100 port expander cable



Home> Wrench icon> GPS Receiver > Setup (password 2009 if needed)

- 2 On the GPS Receiver setup page change the Corrections to CenterPoint RTK

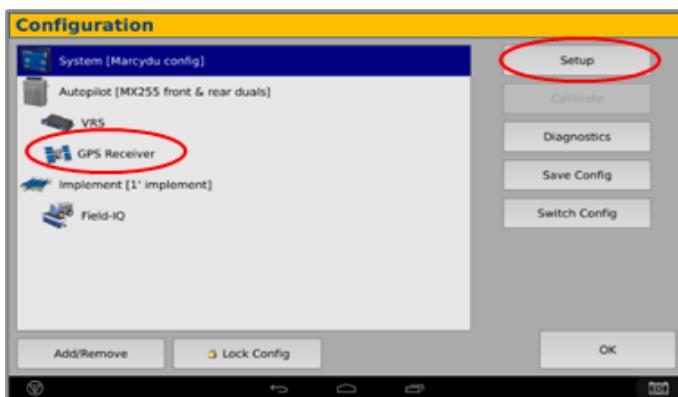

- 3 Select xFill tab> verify settings according to screenshot below

- 4 Select OK to return to Configuration page & select System> Setup

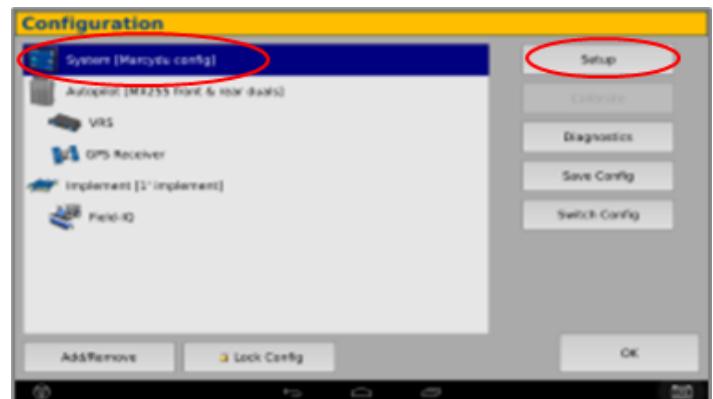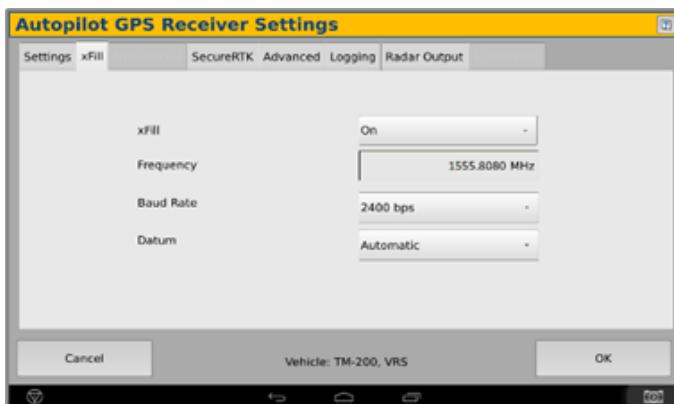

Continue installation on back page



Technical Support
319.531.7574
support@digifarm.com




Quick Reference Card

Trimble XCN 2050/ TMX 2050 & RV50 Installation & Set-up


5 Scroll down & select Port setup> Setup



6 Select the EXP-100 serial # from the AG 815 Secondary Serial dropdown

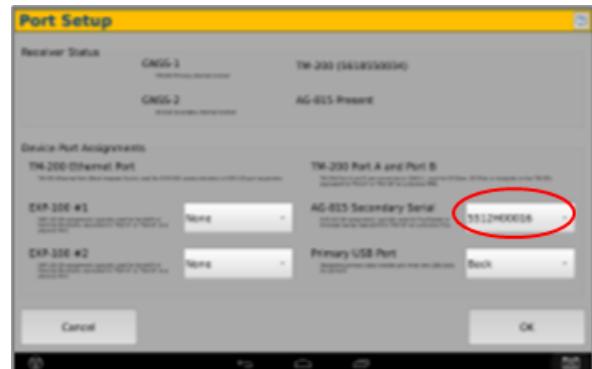

7 Select OK to return to the Configuration page & select GPS receiver & Diagnostics

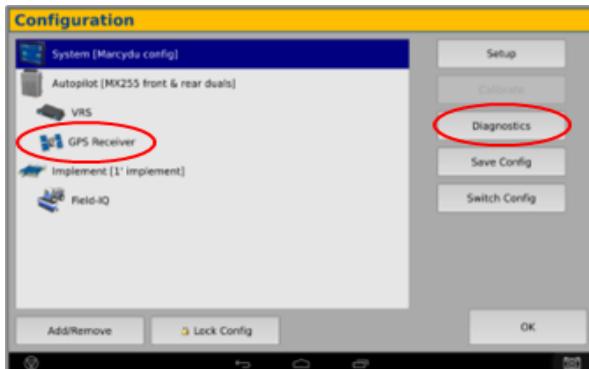

8 Select Ag Remote



9 Ag Remote Setup instructions

Right arrow twice to Configuration> Down arrow to Configuration menu> Right arrow to Port D config> Down arrow to Enter

Right arrow once to select TSIP & Up arrow to change TSIP to RTCM

*Confirm Baud rate is set to 38k4> Right arrow 5x to the Bottom TSIP & Up arrow to change to NONE

Press Enter (confirm settings according to screenshot)> Esc icon 3x to return to the main screen

Confirm RTK (with capital R) in top left and A:####

